

Size:(length\*height\*width):110mm\*120mm\*12.8mm

### Ordering Information

TT-600 Din rail mount temperature transmitter

#### Technical data

Inputs Thermocouple(K,E,J,T,R,S,N,Wre 3-25)

RTD(PT100, Cu50, PT1000)

\*Pt1000 inputs needs to be custom made the unit won't support Pt100 and Cu50 if it is made to support PT1000.

**Excitation current** 0.2mA Lead wire resistance 0~20Ω

Allowable load resistance  $≤500\Omega$  for output 4-20mA

Power supply 20-30Vdc Measuring accuracy 0.1%F.S Temperature drift +/- 50ppm/°C

Open loop Output maximum current and LED indicator flashing when temperature sensor disconnected, the

output will be 21mA and the power source indicator flashing, indicates there is a problem


with the temperature sensor

Response time ≤200mS -25~60°C Operating temperature

Humidity 0-90%RH(No condensation) Weight About 0.1kg  $\geq$  100M  $\Omega$ /500VDC Insulation resistance

Isolation between input/output/source 2000V/1 min

### Product dimension and installation

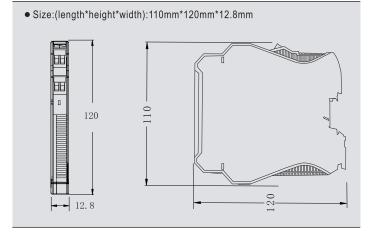


## **Features:**


- 1 input 1 output, isolated temperature transmitter
- Input thermocouple(K,E,J,T,R,S,N,Wre3-25,) RTD(PT100, Cu50,PT1000)
- Isolation between input, output, and power source
- Input and range programmable via PC software
- 0.1%F.S measuring accuracy
- Only a regular USB to type C cable needed for programming
- Source: 18-35Vdc
- DIN rail mount




#### Installation

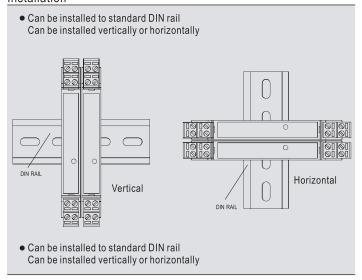

# Wiring diagram

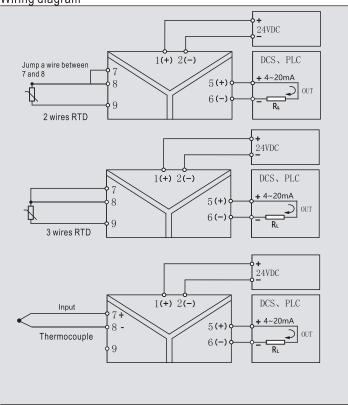

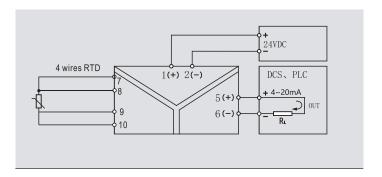

www.maxwell-fa.com sales@maxwell-fa.com Tele/Fax: +86-592-6382791 2